

Tropical Hardwoods—Tradewinds Bright



Pioneer millworks
RECLAIMED & SUSTAINABLE WOOD PRODUCTS



Salvaged from containers used in the international shipping industry, this Tropical Hardwoods Mix includes a multitude of exotic species. The Tradewinds Bright grade features a range of reds, tans, golds, and browns; all smooth planed to create a bright dynamic rainbow across the floor or wall.



Pioneer Millworks

Tropical Hardwoods—Tradewinds Bright

2/2018

CUT AND PASTE SPECIFICATION INTO APPROPRIATE CSI DIVISION

09 64 29—Wood Strip and Plank Flooring
06 42 00—Wood Paneling

MANUFACTURER

Pioneer Millworks
1180 Commercial Drive
Farmington, NY 14425
Phone: 800-951-9663

Pioneer Millworks
2609 SE 6th Avenue
Portland, OR 97202
Phone: 503-719-4800

MATERIALS

1. **Product Name:** Tropical Hardwoods Tradewinds Bright
2. **Species/Description:** Asian Mixed Hardwoods, smooth planed
3. **Source:** Reclaimed shipping dunnage
4. **Color:** Tones may vary widely, ranging from yellow to red to brown. Unlimited color variation is inherent to the product.
5. **Grade:** Tradewinds Bright
6. **Dimensions:**
 - Solid**
TH—1/2" or 5/8" as specified
WD—3" nominal
LG—18" to 84" random
 - Engineered**
TH—N.A.
WD—N.A.
LG—N.A.
7. **Milling:** Tongue and Groove Square Edge (TGSQE) or Surfaced on four faces (S4S)
8. **Finish:** Unfinished unless specified otherwise
9. **Hardness:** 1100–3000
(Janka Ball Test ASTM D1037-96A, Natural wood products have no minimum hardness since hardness is a characteristic of species and cannot be controlled)
10. **FSC Claim:** (SCS-COC-003998)
 - Solid: Recycled 100%
 - Engineered: N.A.

ADDITIONAL INFORMATION


- Heartwood:** No restriction
Grain: No restriction
Knots: No limitations on sound knots, surface defects from chipped or open knots may be present.
Texture: Surface should be 95% clear of saw marks or patina.
Voids: Nail, bolt and other mechanical holes can be present and occasionally reach 3/8" in diameter. Surface defects from insect marks, including pin holes may be present.
Discoloration: Ferrous staining from previous fasteners may be present.
Checks: Structural checks not affecting the integrity of the plank, once installed, are allowed.
Moisture Content: Kiln dried 6–9% prior to milling.

LEED INFORMATION

- MRC3: Materials Reuse
(materials used for this credit cannot be applied to MRC4 or MRC5)
MRC4: Recycled Content, 100% Post-Consumer Recycled Content
(materials used for this credit cannot be applied to MRC3 or MRC7)
MRC5: Regional Materials (call for details)
MRC7: Solid Materials are FSC Recycled 100%

RECOMMENDED OVERAGE

Recommend 7–12% additional material for on-site grading, trimming and installation factors.

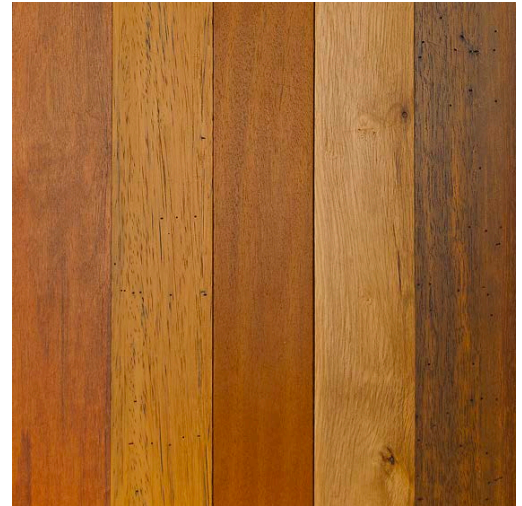

Information is deemed reliable but subject to change. All photos for representation only. Additional information available at our website or call our wood design experts.