

Mixed Softwoods—Grandma's Attic



Pioneer millworks
RECLAIMED & SUSTAINABLE WOOD PRODUCTS



A mix of softwood species, carefully selected for its original patina and partially planed to leave much of the texture intact, Grandma's Attic is a casual and authentic take

on reclaimed wood for floors or walls. Once installed it has a way of looking like it's been there forever.



Pioneer Millworks

Mixed Softwoods—Grandma's Attic

7/2018

CUT AND PASTE SPECIFICATION INTO APPROPRIATE CSI DIVISION

09 64 29—Wood strip and plank flooring
06 42 00—Wood Paneling

MANUFACTURER

Pioneer Millworks
1180 Commercial Drive
Farmington, NY 14425
Phone: 800-951-9663

Pioneer Millworks
2609 SE 6th Avenue
Portland, OR 97202
Phone: 503-719-4800

MATERIALS

1. **Product Name:** Grandma's Attic Mixed Softwoods
2. **Species/Description:** Domestic Softwoods with original patina
3. **Source:** Agricultural/Industrial deconstruction
4. **Color:** Tones may range from gold to brown to grey.
Unlimited color variation is inherent to the product.
5. **Grade:** Grandma's Attic
6. **Dimensions:**
 - Solid**
TH—3/4"
WD—3" to 10" as specified
LG—18" to 144" random
 - Engineered**
TH—N.A.
WD—N.A.
LG—N.A.
7. **Milling:** Tongue and Groove Square Edge (TGSQE)
8. **Finish:** Unfinished unless specified otherwise
9. **Hardness:** 420–870
(Janka Ball Test ASTM D1037-96A, Natural wood products have no minimum hardness since hardness is a characteristic of species and cannot be controlled)
10. **FSC Claim:** (SCS-COC-003998)
 - Solid: Recycled 100%
 - Engineered: N.A.

ADDITIONAL INFORMATION


Heartwood: No restriction
Grain: No restriction
Knots: No limitations on sound knots, surface defects from chipped or open knots may be present.
Texture: This mixture shows a varied pattern of saw marks, wear patterns, colors and textures. Material surfaced so that 60% of original patina remains with nearly all boards having some patina. Overwood of up to 1/8" can be expected.
Voids: Nail, bolt and other mechanical holes can be present and occasionally reach 1" in diameter. Surface defects from insect marks, including pin holes may be present. Peg or bolt holes are often left open in longer planks.
Discoloration: Ferrous staining from previous fasteners may be present.
Checks: Structural checks not affecting the integrity of the plank, once installed, are allowed and more prevalent as the width of the material increases.
Moisture Content: Kiln dried 6–9% prior to milling.

LEED INFORMATION

MRc3: Materials Reuse
(materials used for this credit cannot be applied to MRc4 or MRc5)
MRc4: Recycled Content, 100% Post-Consumer Recycled Content
(materials used for this credit cannot be applied to MRc3 or MRc7)
MRc5: Regional Materials (call for details)
MRc7: Solid Materials are FSC Recycled 100%

RECOMMENDED OVERAGE

Recommend 7–12% additional material for on-site grading, trimming and installation factors.

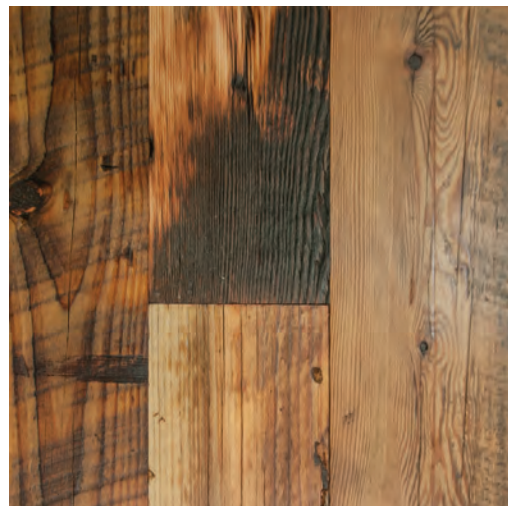

Information is deemed reliable but subject to change. All photos for representation only. Additional information available at our website or call our wood design experts.