


# Tradewinds Patina—Tropical Hardwoods



**Pioneer Millworks**  
RECLAIMED & SUSTAINABLE WOOD PRODUCTS



Salvaged from containers used in the international shipping industry, this mix of Tropical Hardwoods includes a multitude of exotic species. The Tradewinds Patina grade features rugged reds, browns, and golds, with deep, dark strap marks creating bold patterning on these narrow reclaimed planks.

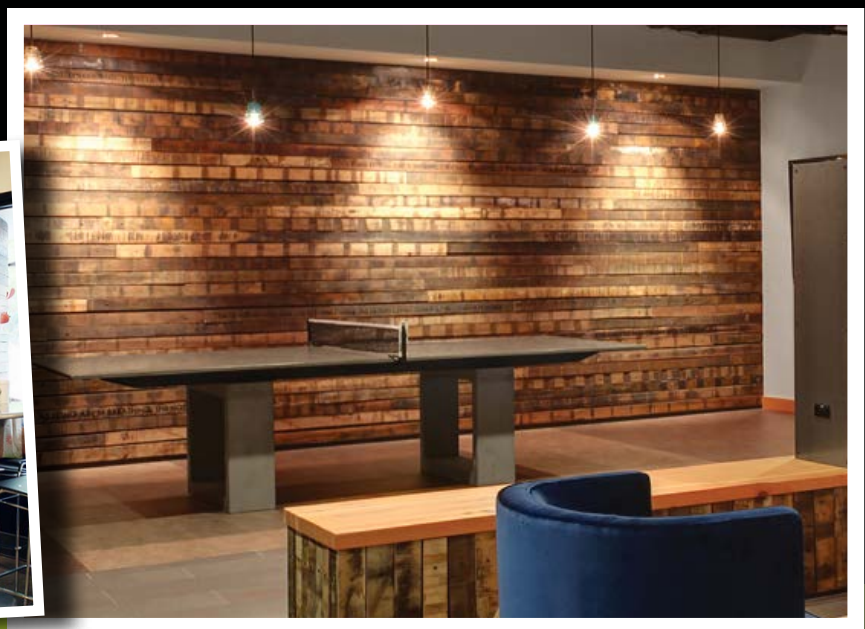

# Pioneer Millworks

## Tradewinds Patina—Tropical Hardwoods

1/2020

### CUT AND PASTE SPECIFICATION INTO APPROPRIATE CSI DIVISION

09 64 29—Wood Strip and Plank Flooring  
06 42 00—Wood Paneling

### MANUFACTURER

Pioneer Millworks  
1180 Commercial Drive  
Farmington, NY 14425  
Phone: 800-951-9663

Pioneer Millworks  
2609 SE 6th Avenue  
Portland, OR 97202  
Phone: 503-719-4800

### MATERIALS

1. **Product Name:** Tradewinds Patina Tropical Hardwoods
2. **Species/Description:** Asian Mixed Hardwoods with original patina
3. **Source:** Reclaimed shipping dunnage
4. **Color:** Tones may vary widely, ranging from yellow to brown to black. Unlimited color variation is inherent to the product.
5. **Grade:** Tradewinds Patina
6. **Dimensions:**
  - Solid**  
TH—1/2" or 5/8" as specified  
WD—3" nominal  
LG—18" to 84" random
  - Engineered**  
TH—N.A.  
WD—N.A.  
LG—N.A.
7. **Milling:** Tongue and Groove Square Edge (TGSQE) or Surfaced on three faces (S3S)
8. **Finish:** Unfinished unless specified otherwise
9. **Hardness:** 1100–3000  
(Janka Ball Test ASTM D1037-96A, Natural wood products have no minimum hardness since hardness is a characteristic of species and cannot be controlled)
10. **FSC Claim:** (SCS-COC-003998)
  - Solid:** FSC Recycled 100%
  - Engineered:** N.A.

### ADDITIONAL INFORMATION


**Heartwood:** No restriction  
**Grain:** No restriction  
**Knots:** No limitations on sound knots, surface defects from chipped or open knots may be present.  
**Texture:** This mixture shows a varied pattern of saw marks, wear patterns, colors and textures. Overwood of up to 1/8" can be expected.  
**Voids:** Fastener holes can be present and occasionally reach 3/8" in diameter. Surface defects from insect marks, including pin holes may be present.  
**Discoloration:** Ferrous staining from previous fasteners may be present.  
**Checks:** Structural checks not affecting the integrity of the plank, once installed, are allowed.  
**Moisture Content:** Kiln dried 6–9% prior to milling.

### LEED INFORMATION

MRc3: Materials Reuse  
(materials used for this credit cannot be applied to MRc4 or MRc5)  
MRc4: Recycled Content, 100% Post-Consumer Recycled Content  
(materials used for this credit cannot be applied to MRc3 or MRc7)  
MRc5: Regional Materials (call for details)  
MRc7: Solid Materials are FSC Recycled 100%

### RECOMMENDED OVERAGE

Recommend 7–12% additional material for on-site grading, trimming and installation factors.

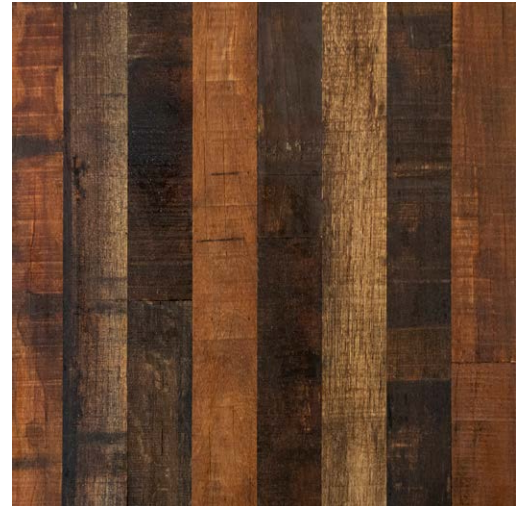

The mark of responsible forestry



Information is deemed reliable but subject to change. All photos for representation only. Additional information available at our website or call our wood design experts.