

# Hickory—American Gothic

Pioneer millworks  
RECLAIMED & SUSTAINABLE WOOD PRODUCTS



Dramatic contrasting knots and sapwood are the hallmarks of our reclaimed Hickory, typically salvaged from barns. It's the hardest of our domestic species and wears superbly. Expect chocolate and vanilla color tones, swirling grain, limited nail holes, and occasional insect marks that create a distinctive pattern.



# Pioneer Millworks Hickory—American Gothic

3/2023

## CUT AND PASTE SPECIFICATION INTO APPROPRIATE CSI DIVISION

09 64 29—Wood Strip and Plank Flooring

06 42 00—Wood Paneling

## MANUFACTURER

Pioneer Millworks East  
1180 Commercial Drive  
Farmington, NY 14425  
Phone: 800-951-9663

Pioneer Millworks West  
2655 NE Orchard Ave.  
McMinnville, OR 97128  
Phone: 503-437-9017

## MATERIALS

1. **Product Name:** American Gothic Hickory
2. **Species/Description:** Domestic Hickory, smooth planed
3. **Source:** Agricultural/Industrial deconstruction
4. **Color:** Tones may range from cream to brown.  
Unlimited color variation is inherent to the product.
5. **Grade:** American Gothic
6. **Dimensions:**
  - Solid**  
TH—3/4"  
WD—3" to 5" random  
LG—18" to 12' random
  - Engineered**  
TH—N/A  
WD—N/A  
LG—N/A
7. **Milling:** Tongue and Groove Square Edge (TGSQE)
8. **Finish:** Unfinished unless specified otherwise
9. **Hardness:** 1820  
(Janka Ball Test ASTM D1037-96A, Natural wood products have no minimum hardness since hardness is a characteristic of species and cannot be controlled)
10. **FSC Claim:** (SCS-COC-003998)
  - Solid:** FSC Recycled 100%
  - Engineered:** FSC Mix

## ADDITIONAL INFORMATION

**Heartwood:** No restriction

**Grain:** No restriction

**Knots:** No limitations on sound knots, surface defects from chipped or open knots may be present.

**Texture:** Surface should generally be 95% clear of saw marks or patina.

**Voids:** Nail, bolt and other mechanical holes can be present and occasionally reach 3/8" in diameter. Surface defects from insect marks, including pin holes may be present. Peg or bolt holes are often left open in longer planks.

**Discoloration:** Ferrous staining from previous fasteners may be present.

**Checks:** Structural checks not affecting the integrity of the plank, once installed, are allowed and more prevalent as the width of the material increases.

**Moisture Content:** Kiln dried 6–9% prior to milling.

## LEED INFORMATION

**MRC3:** Materials Reuse (materials used for this credit cannot be applied to MRC4 or MRC5)


**MRC4:** Recycled Content, 100% Post-Consumer Recycled Content (materials used for this credit cannot be applied to MRC3 or MRC7)

**MRC5:** Regional Materials (call for details)

**MRC7:** Solid Materials are FSC Recycled 100%; Engineered FSC Mix

## RECOMMENDED OVERAGE

Recommend 7–12% additional material for on-site grading, trimming and installation factors.

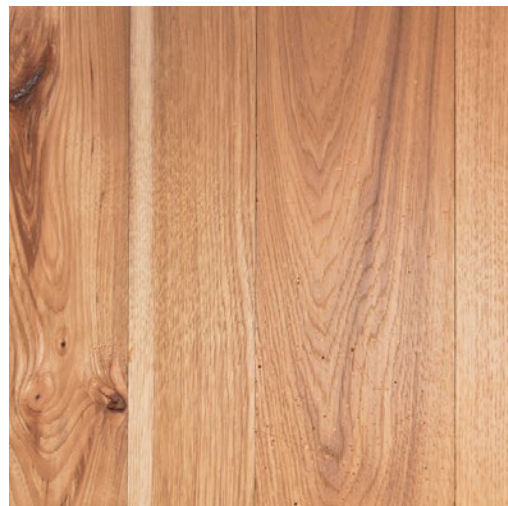

The mark of responsible forestry



Information is deemed reliable but subject to change.  
All photos for representation only. Additional information available at our website or call our wood design experts.