


# Black & Tan—Black Oak



**Pioneer millworks**  
RECLAIMED & SUSTAINABLE WOOD PRODUCTS



We leave the original painted surface of this Oak plank untouched, giving you the rugged texture and weathering of decades of exposure. Dark blacks and weathered greys, with occasional peeks through to the Oak underneath, this non-toxic painted waterproof coating used in agricultural settings was safe for use around the million dollar thoroughbreds that were in daily contact with it. It can be left as is, and used indoors or out.

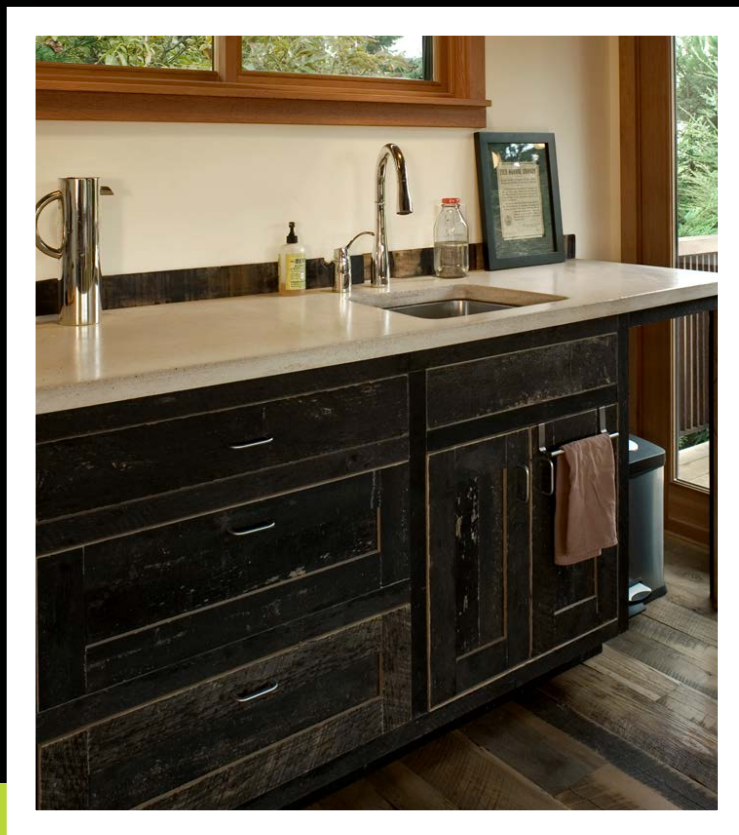

# Pioneer Millworks

## Black & Tan—Black Oak

3/2020

### CUT AND PASTE SPECIFICATION INTO APPROPRIATE CSI DIVISION

09 64 29—Wood Strip and Plank Flooring  
06 42 00—Wood Paneling

### MANUFACTURER

Pioneer Millworks  
1180 Commercial Drive  
Farmington, NY 14425  
Phone: 800-951-9663

Pioneer Millworks  
2609 SE 6th Avenue  
Portland, OR 97202  
Phone: 503-719-4800

### MATERIALS

1. **Product Name:** Black & Tan—Black
2. **Species/Description:** Domestic Red and White Oak with original patina
3. **Source:** Agricultural/Industrial deconstruction
4. **Color:** Tones may range from grey to black.  
Unlimited color variation is inherent to the product.
5. **Grade:** Black
6. **Dimensions:**
  - Solid**  
TH—3/4"  
WD—4" or 5" as specified  
LG—18" to 96" random
  - Engineered**  
TH—N.A.  
WD—N.A.  
LG—N.A.
7. **Milling:** Tongue and Groove Square Edge (TGSQE)
8. **Finish:** Unfinished unless specified otherwise
9. **Hardness:** 1290  
(Janka Ball Test ASTM D1037-96A, Natural wood products have no minimum hardness since hardness is a characteristic of species and cannot be controlled)
10. **FSC Claim:** (SCS-COC-003998)
  - Solid:** FSC Recycled 100%
  - Engineered:** N.A.

### ADDITIONAL INFORMATION

**Heartwood:** No restriction

**Grain:** No restriction

**Knots:** No limitations on sound knots, surface defects from chipped or open knots may be present.

**Texture:** This mixture shows a varied pattern of saw marks, wear patterns, colors and textures. Overwood of up to 1/8" can be expected.

**Voids:** Fastener hole and open knots can be present and occasionally reach 1" in diameter. Surface defects from insect marks, including pin holes may be present. Larger voids are occasionally included to preserve long lengths.

**Discoloration:** Ferrous staining from previous fasteners may be present.

**Checks:** Structural checks not affecting the integrity of the plank, once installed, are allowed and more prevalent as the width of the material increases.

**Moisture Content:** Kiln dried 6–9% prior to milling.

### LEED INFORMATION

M Rc3: Materials Reuse

(materials used for this credit cannot be applied to M Rc4 or M Rc5)

M Rc4: Recycled Content, 100% Post-Consumer Recycled Content

(materials used for this credit cannot be applied to M Rc3 or M Rc7)

M Rc5: Regional Materials (call for details)

M Rc7: Solid Materials are FSC Recycled 100%

### RECOMMENDED OVERAGE

Recommend 7–12% additional material for on-site grading, trimming and installation factors.



The mark of responsible forestry



Information is deemed reliable but subject to change. All photos for representation only. Additional information available at our website or call our wood design experts.