

American Prairie—Brown Board



Pioneer millworks
RECLAIMED & SUSTAINABLE WOOD PRODUCTS



Our take on reclaimed barn wood paneling is broad and dynamic in scope, incorporating wood that is salvaged not just from barns but also agricultural fencing and other structures that have endured the elements. Brown Board features rich tones and a variety of original textures: planed, rough sawn, and lightly weathered.

Our customers most often use this reclaimed wood for paneling and ceilings, adding special touches to kitchen islands, counters, and custom spaces.



Pioneer Millworks American Prairie—Brown Board

4/2021

CUT AND PASTE SPECIFICATION INTO APPROPRIATE CSI DIVISION

06 42 00—Wood Paneling

07 46 23—Wood Siding

MANUFACTURER

Pioneer Millworks
1180 Commercial Drive
Farmington, NY 14425
Phone: 800-951-9663

Pioneer Millworks
2609 SE 6th Avenue
Portland, OR 97202
Phone: 503-719-4800

MATERIALS

1. **Product Name:** American Prairie Brown Board
2. **Species/Description:** Domestic Mixed Hardwoods and/or Softwoods with original patina
3. **Source:** Agricultural/Industrial deconstruction
4. **Color:** Tones may range from tan to brown.
Unlimited color variation is inherent to the product.
5. **Grade:** Brown Board
6. **Dimensions:**
 - Solid**
TH—5/8" to 1" variable
WD—4" to 10" as specified
LG—24" to 144" random
 - Engineered**
TH—N.A.
WD—N.A.
LG—N.A.
7. **Milling:** Ripped on two edges (R2E)
8. **Finish:** Unfinished unless specified otherwise
9. **Hardness:** 420–1100
(Janka Ball Test ASTM D1037-96A, Natural wood products have no minimum hardness since hardness is a characteristic of species and cannot be controlled)
10. **FSC Claim:** (SCS-COC-003998)
 - Solid:** FSC Recycled 100%
 - Engineered:** N.A.

ADDITIONAL INFORMATION

Heartwood: No restriction

Grain: No restriction

Knots: No limitations on sound knots, surface defects from chipped or open knots may be present.

Texture: This mixture shows a varied pattern of saw marks, wear patterns, colors and textures. Overwood of up to 1/4" can be expected.

Voids: Fastener holes and open knots can be present and may reach 2" in diameter. Larger voids are occasionally included to preserve long lengths. Surface defects from insect marks, including pin holes may be present.

Discoloration: Ferrous staining from previous fasteners may be present.

Checks: Structural checks not affecting the integrity of the plank, once installed, are allowed and more prevalent as the width of the material increases.

Moisture Content: Kiln dried 6–9% prior to milling.

LEED INFORMATION

MRC3: Materials Reuse

(materials used for this credit cannot be applied to MRC4 or MRC5)

MRC4: Recycled Content, 100% Post-Consumer Recycled Content


(materials used for this credit cannot be applied to MRC3 or MRC7)

MRC5: Regional Materials (call for details)

MRC7: Solid Materials are FSC Recycled 100%

RECOMMENDED OVERAGE

Recommend 7–12% additional material for on-site grading, trimming and installation factors.

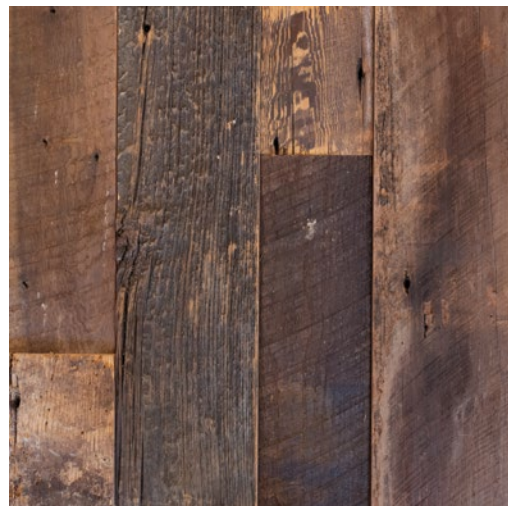

The mark of responsible forestry



Information is deemed reliable but subject to change. All photos for representation only. Additional information available at our website or call our wood design experts.