

# Sports Collection—Bleacher Board

Pioneer millworks  
RECLAIMED & SUSTAINABLE WOOD PRODUCTS



Familiar to most of us from our school days, these boards were there for the cheering, jeering, stomping, and private 'under the stands' rendezvous. We salvage Bleacher Boards from athletic facilities across the nation. The cream of the crop: solid, clear grain Douglas fir seat boards. We also have multistrip Douglas fir and both solid and multistrip Southern Yellow Pine boards. As-found with bull nose edges intact, or customized into flooring with precision milled tongue & groove (we'll even remove the gum) these nostalgic boards can do it all.



# Pioneer Millworks Sports Collection—Bleacher Board

6/2021

## CUT AND PASTE SPECIFICATION INTO APPROPRIATE CSI DIVISION

09 64 29—Wood strip and plank flooring

06 42 00—Wood Paneling

## MANUFACTURER

Pioneer Millworks  
1180 Commercial Drive  
Farmington, NY 14425  
Phone: 800-951-9663

Pioneer Millworks  
2609 SE 6th Avenue  
Portland, OR 97202  
Phone: 503-719-4800

## MATERIALS

- Product Name:** Bleacher Board
- Species/Description:** Douglas Fir & Southern Yellow Pine reclaimed bleacher board
- Source:** Educational institutions and athletic facilities
- Color:** Range of ambers and browns, unlimited color variation is inherent to the product
- Grade:** Bleacher Board
- Dimensions:**
  - TH  
Variable .75"–1" (as-found),  
.75" (milled Tongue and Groove)
  - WD  
Variable 8.5"–9.5" (as-found),  
8.25" finished face (milled Tongue and Groove)
  - LG  
Mixed 2' to 12'
- Milling:** As Found or Tongue & Groove Square Edge (TGSQE)
- Finish:** Unfinished or Other
- Hardness:** 660–1225 (Janka Ball Test ASTM D1037-96A, Natural wood products have no minimum hardness since hardness is a characteristic of species and cannot be controlled)
- FSC Claim:** Recycled 100% (SCS-COC-003998)

## ADDITIONAL INFORMATION


- Grain:** No restriction on mixture of flat sawn and vertical grain  
**Knots:** Clear grade relatively free of knots  
**Texture:** Smooth finished surface  
**Holes:** Bolt holes from its previous life are present  
**Moisture Content:** Kiln dried 6–9% unless otherwise requested

## LEED INFORMATION

- MRc3:** Materials Reuse (materials used for this credit cannot be applied to MRc4 or MRc7)  
**MRc4:** Recycled Content, 100% Post consumer Recycled Content (materials used for this credit cannot be applied to MRc3 or MRc7)  
**MRc5:** Regional Materials (call for details)  
**MRc7:** Certified Wood—Materials are FSC Recycled 100%

## EXTRA MATERIALS

Recommend 7–10% additional material for on-site grading, trimming and installation factors

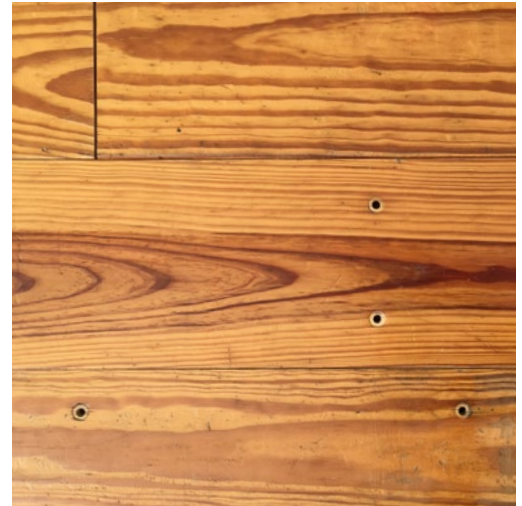

Information is deemed reliable but subject to change. All photos for representation only. Additional information available at our website or call our wood design experts.