

American Prairie—Redwood Collection

Pioneer Millworks
RECLAIMED & SUSTAINABLE WOOD PRODUCTS



Salvaged primarily from California fences, our Redwood Collection features a range of weathering and patina from ocher brown to charcoal grey. Nail holes and knots may be present. Good for both interior and exterior applications.



Pioneer Millworks American Prairie—Redwood Collection

12/2022

CUT AND PASTE SPECIFICATION INTO APPROPRIATE CSI DIVISION

06 42 00—Wood Paneling

07 46 23—Wood Siding

MANUFACTURER

Pioneer Millworks East
1180 Commercial Drive
Farmington, NY 14425
Phone: 800-951-9663

Pioneer Millworks West
2655 NE Orchard Ave.
McMinnville, OR 97128
Phone: 503-437-9017

MATERIALS

1. **Product Name:** American Prairie Redwood Collection
2. **Species/Description:** Domestic Redwood with original patina
3. **Source:** Agricultural/Industrial deconstruction
4. **Color:** Tones may range from red to brown to grey.
Unlimited color variation is inherent to the product with occasional paint remnants.
5. **Grade:** Redwood Collection
6. **Dimensions:**
Solid
TH—5/8" to 1" variable
WD—5" or 7" as specified
LG—18" to 5' random
Engineered
TH—N.A.
WD—N.A.
LG—N.A.
7. **Milling:** Ripped on two edges (R2E), surfaced 3 sides (S3S) available upon request
8. **Finish:** Unfinished unless specified otherwise
9. **Hardness:** 480
(Janka Ball Test ASTM D1037-96A, Natural wood products have no minimum hardness since hardness is a characteristic of species and cannot be controlled)
10. **FSC Claim:** (SCS-COC-003998)
Solid: FSC Recycled 100%
Engineered: N.A.

ADDITIONAL INFORMATION

Heartwood: No restriction

Grain: No restriction

Knots: No limitations on sound knots, surface defects from chipped or open knots may be present.

Texture: This mixture shows a varied pattern of saw marks, wear patterns, colors and textures. Overwood of up to 1/8" can be expected.

Voids: Fastener holes and open knots can be present and may reach 2" in diameter in solid paneling. Larger voids are occasionally included to preserve long lengths. Surface defects from insect marks, including pin holes may be present.

Discoloration: Ferrus staining from previous fasteners may be present.

Checks: Structural checks not affecting the integrity of the plank, once installed, are allowed and more prevalent as the width of the material increases.

Moisture Content: Kiln dried 6–9% prior to milling.

LEED INFORMATION

MRC3: Materials Reuse

(materials used for this credit cannot be applied to MRC4 or MRC5)

MRC4: Recycled Content, 100% Post-Consumer Recycled Content


(materials used for this credit cannot be applied to MRC3 or MRC7)

MRC5: Regional Materials (call for details)

MRC7: Solid Materials are FSC Recycled 100%

RECOMMENDED OVERAGE

Recommend 10-15% additional material for on-site grading, trimming and installation factors.

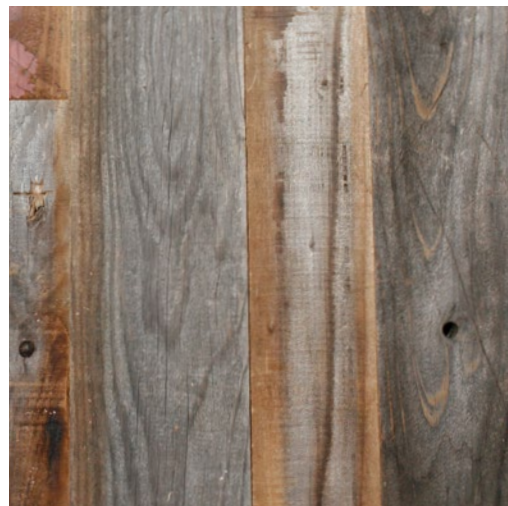

The mark of responsible forestry.



Information is deemed reliable but subject to change. All photos for representation only. Additional information available at our website or call our wood design experts.